 


**WEBB'S MACHINERY (VEGREVILLE) LTD.**

5342 - 50th Ave.
VEGREVILLE, AB T9C-1M3
Tel: 780-632-6772 Fax: 780-632-3223



SWARE VENTURES INC.
C/O DON SWARE
R.R. 4
TOFIELD AB T0B 4J0

Indubia
Page 1
STMT DATE: 09/30/2016
PHONE: 780-662-3080
CUSTOMER NO: 01148

A SERVICE CHARGE AT A RATE OF 2% PER MONTH (24% PER ANNUM) APPLIED TO ALL OVERDUE ACCOUNTS.

DATE	REFERENCE	✓	CHARGES	PAST DUE AMOUNT	DAYS	DATE PAID	AMOUNT PAID	UNPAID BALANCE
PREVIOUS BALANCE: 090516	14385B		20667.99 ✓		25			0.00
CURRENT PERIOD CHARGES \$20667.99								
***** THANK YOU FOR YOUR BUSINESS AND HAVE A NICE DAY *****								
#0608 Oct. 25/2016								

ANALYSIS OF ACCOUNT					TOTAL BALANCE DUE
CURRENT	OVER 30 DAYS	OVER 60 DAYS	OVER 90 DAYS	OVER 120 DAYS	
20667.99	0.00	0.00	0.00	0.00	
STATEMENT					20667.99

SWARE VENTURES INC.

01148

09/30/2016

Total Amt. Paid _____



WEBB'S MACHINERY (VEGREVILLE) LTD.
5342 - 50th Ave.
VEGREVILLE, AB T9C-1M3
Tel: 780-632-6772 Fax: 780-632-3223



RO: 8898
Invoice: 14385
Date: 09/05/201

SWARE VENTURES INC.
C/O DON SWARE
R.R. 4
TOFIELD, AB T0B 4J0

Year		Make/Model		Serial Number		
		2007 NH CR9070		HAJ110196		
Stock No	PO	Misc Information	Tag	Customer	Telephone	
3467				01143	780-662-308	

Cond	OpCode	T	Description	Quantity	List	Net	Total
------	--------	---	-------------	----------	------	-----	-------

Type: COMBINE RO Open Date: 08/03/16 Sold: 01/21/13
Meter In: 2075

001

INSPECTION

D PERFORM A COMPLETE INSPECTION ON UNIT MAKE A LIST OF NEEDED REPAIRS FOR CUSTOMER TO REVEIW
F JARDEN- WENT THROUGH ENTIRE TRIPLE CHECK LIST, REPLACED BULBS, AND FIXED ELECTRICAL ISSUE FOR THE REAR BRAKE LIGHT. CHECKED OILS, CHECKED CHAINS TENSION AND BELT TENSION. CHECKED ALL WORK LIGHTS AND ALL CIGARETTE LIGHTER PLUG INS. TORQUED TIRES, CHECKED TIRE PRESSURE, CHECKED REAR TIRE BEARINGS. REMOVED SIEVES, REMOVED ENGINE COVER, TEFLON TAPED ROTOR GEARBOX BREATHERS AND TIGHTENED THEM UP. HELPED REMOVE BOLTS FROM CLEANING FAN AND REINSTALL THEM.

CLAB

L CUSTOMER LABOUR

2760.00

P 75089 BRAKLEEN

5.00

5.75

28.75

P 1156 BULB

1.00

0.80

0.80

P 84155097 BULB

2.00

29.70

59.40

Subtotal charges this section

2848.95

002

CLEANING FAN

D SEE WHY THE CLEANING FAN SHEILDS ARE GETTING WRECKED ON THE RH SIDE OF MACHINE.INSPECT SHOE PIVOTS AND INSURE THAT THE BOLT THAT USUALLY CATCHES THESE SHEILDS IS FLIPPED. CUSTOMER WANTS TO KNOW WHY THIS KEEPS HAPPENING AND IF SHEILDS CAN BE REPAIRED OR NEED TO BE REPLACED AGAIN

CLAB

L CUSTOMER LABOUR

690.00

P 94792DS BLK PAINT

1.00

14.30

14.30

P 87011193 SHIELD

1.00

206.80

206.80

P 86583204 GUARD

1.00

379.50

379.50

P 87011191 SHIELD

1.00

117.70

117.70

P 87011195 SHIELD

1.00

162.80

162.80

P 412649 WASHER, SP

3.00

2.40

7.20

P 85807132 NUT

1.00

3.85

3.85

P 84074380 PULLEY

1.00

190.30

190.30

P MFR FREIGHT

1.00

69.86

69.86

Subtotal charges this section

1842.31

003

ENGINE THERMOSTAT

D REPLACE ENGINE THERMOSTAT ENGINE IS ONLY REACHING 140 (2.5)
F DRAINED COOLANT
TOOK OFF SHIELDS SO I COULD GET TO THE THERMOSTAT
TOOK OFF COOLANT LINES
UNBOLTED THERMOSTAT
SWITCHED OVER TO FITTING FROM THE OLD ONE TO THE NEW ONE
BOLTED THE NEW THERMOSTAT IN

 
webb_servicing1.rpt.htm

REPRINT

page 1 of 8



WEBB'S MACHINERY (VEGREVILLE) LTD.
5342 - 50th Ave.
VEGREVILLE, AB T9C-1M3
Tel: 780-632-6772 Fax: 780-632-3223



SWARE VENTURES INC.
C/O DON SWARE
R.R. 4
TOFIELD, AB T0B 4J0

RO: 8898B
Invoice: 14385B
Date: 09/05/2016


Year		Make/Model		Serial Number		
		2007 NH CR9070		HAJ110196		
Stock No	PO	Misc Information		Tag	Customer	Telephone
3467					01148	780-662-3080

Code	OpCode	T	Description	Quantity	Unit	Net	Total
			HOOKED UP THE TWO COOLANT LINES REUSED THE OLD COOLANT PUT SHIELDS ON				
	CLAB		L CUSTOMER LABOUR				345.00
			P 5802055311 REGULATOR	1.00		433.35	433.35
			P B30204C ANTIFREEZE	2.00		16.48	32.96
004			Subtotal charges this section				
							811.31
			SERVICE				
			D CHANGE ENGINE OIL AND FILTER. CHANGE FUEL FILTERS AND HYD FILTERS MAKE SURE ALL FILTERS ARE LABELED WITH HRS. CHANGE ENGINE AIR FILTERS INNER AND OUTER CUSTOMER WANTS THE OLD OUTTER FILTER PLACED IN THE CAB FOR HIM TO TAKE HOME. (3) F CHANGE FUEL FILTERS, HYDRAULIC FILTERS, TOP UP HYDRAULIC OILS, TOP UP GEAR CASE OIL, LABEL FILTERS WITH DATE AND HOURS CHANGED. CHANGE ENGINE AIR FILTERS, INNER AND OUTER, FIXED AND VERIFIED, G.S.				
	CLAB		L CUSTOMER LABOUR				414.00
			P 84346773 FILTER, EN	2.00		70.68	141.36
			P FILTERS > 8" - 1.00 EHC2	6.00		1.00	6.00
			P 84597068 FILTER, FU	1.00		70.95	70.95
			P FILTERS EHC1	1.00		0.50	0.50
			P 84348883 FILTER, FU	1.00		44.83	44.83
			P 84226258 FILTER, HY	3.00		76.18	228.54
			P 86998333 FILTER, AI	1.00		137.50	137.50
			P 86998332 FILTER, AI	1.00		103.68	103.68
			P 73341751 15W40 9.46	1.00		56.98	56.98
			P OIL CONTAINER CHARGE EHC6	2.00		0.95	1.90
			P 73341752 15W40 OIL	1.00		104.50	104.50
			P OIL CONTAINER CHARGE EHC13	1.00		1.90	1.90
			P 73341773 ULTRA TRAC	1.00		59.68	59.68
			Subtotal charges this section				
							1372.32
005			PARK BRAKE				
			D REPAIR OIL LEAK ON RH SIDE OF TRANS WHERE THE PARK BRAKE MEETS THE TRANS (3.5) F JR-DID TROUBLESHOOT. FOUND IT LEAKING ON SHIFTING FORK SHAFT WHERE THE SHAFT COMES TROUGH THE HOUSING. (IT SEALS WITH AN O RING) -IN ORDER TO REMOVE O RINGS HAD TO REMOVE HYDRO MOTOR. -REPLACED O RING ON LH AND RH. -REPLACED SNAP RINGS WITH NEW ONES . -DID TROUBLESHOOT ON HYDRO MOTOR LEAK FOUND IT LEAKING FROM TRANSMISSION SEAL. -IN ORDER TO REMOVE TRANS SEAL HAD TO MOVE HYDRO MOTOR.				

REPRINT



 WEBB'S MACHINERY (VEGREVILLE) LTD.
5342 - 50th Ave.
VEGREVILLE, AB T9C-1M3
Tel: 780-632-6772 Fax: 780-632-3223



RO: 8898B
Invoice: 14385B
Date: 09/05/2016

SWARE VENTURES INC.
C/O DON SWARE
R.R. 4
TOFIELD, AB T0B 4J0

Year		Make/Model		Serial Number		
		2007 NH CR9070		HAJ110196		
Stock No	PO	Misc Information		Tag	Customer	Telephone
3467					01148	780-662-3080

Cond	OpCode	T	Description	Quantity	Unit	Net	Total
			-REMOVED SHIELD AND TWO HOSE CLAMPS				
			-DRAINED OIL				
			-REPLACED TRANS SEAL AND O RING. ALSO PUT SOME SILICONE FOR BETTER SEALING				
			-REINSTALLED SIDE SHIELD AND HOSE CLAMPS.				
			-PUT OIL BACK IN.				
			FIXED AND VERIFIED				
	CLAB		L CUSTOMER LABOUR				483.00
			P 84078052 O-RING	2.00		4.37	8.74
			P 84045429 SEAL, RING	1.00		82.23	82.23
			P 84032297 O-RING	1.00		7.94	7.94
			Subtotal charges this section				581.91
006			FEEDER SLATS				
			D STRAIGHTIN 6 BENT FEEDER SLATS INSPECT THEM CAREFULLY TO MAKE SURE THE BENT ONES ARE NOT CRACKED IF CRACKED REPLACE THEM (1.5)				
			F REMOVE BENT FEEDER CHAIN SLATS, STRAIGHTEN BENT SLATS, CHECK FOR CRACKS ON THEM.INSTALL SLATS , LOCTITE BOLTS. FIXED AND VERIFIED , G.S.				
	CLAB		L CUSTOMER LABOUR				207.00
			Subtotal charges this section				207.00
007			PSD COUPLER				
			D REPLACE WORN PSD COUPLER WHEN NEW COUPLER IS INSTALLED MAKE SURE IT IS ALL SQUARE (1)				
			F UNBOLTED HYD MOTOR				
			USED A PULLER TO GET THE ONE HALF OF THE COUPLER OFF				
			TOOK THE OTHER HALF OFF THE SHAFT BY THE PSD BELT				
			REINSTALLED NEW COUPLER				
			BOLTED HYD MOTOR ON				
	CLAB		L CUSTOMER LABOUR				138.00
			P 87042661 COUPLING	1.00		180.40	180.40
			P 9807617 KIT, SEALS	1.00		75.63	75.63
			Subtotal charges this section				394.03
008			SEIVES				
			D REPLACE BROKEN PRE SEIVE(1) AND RH LOWER SEIVE. THEY ARE BOTH BROKEN.INSTALL BUSHING UPGRADE INTO ALL SEIVE LINKAGE (1.5)INSTALL NEW RUBBER CURTAINS ON BOTH TOP SEIVES (0.5)				
			F INSTALLED PRE SIEVE, SILICONE THE NEW BOTTOM SIEVE. DYLAN				
	CLAB		L CUSTOMER LABOUR				414.00
			P 84319323 SIEVE	1.00		883.75	883.75
			P 743083 CANVAS	1.00		172.70	172.70
			P 47389902 SIEVE	1.00		949.40	949.40
			P BED55302 BRONZE BUS	1.00		1.77	1.77
			P 47389898 SIEVE	1.00		813.05	813.05

webb_servicing1.tmp.pas

 
REPRINT

page 3 of 8



WEBB'S MACHINERY (VEGREVILLE) LTD.

5342 - 50th Ave.
VEGREVILLE, AB T9C-1M3
Tel: 780-632-6772 Fax: 780-632-3223



RO: 8898B
Invoice: 14385B
Date: 09/05/2016

SWARE VENTURES INC.
C/O DON SWARE
R.R. 4
TOFIELD, AB T0B 4J0

Year		Make/Model		Serial Number	
2007		NH CR9070		HAJ110196	
Stock No	PO	Misc Information	Tag	Customer	Telephone
3467				01148	780-662-3080

Cond	OpCode	T	Description	Quantity	Unit	Net	Total
------	--------	---	-------------	----------	------	-----	-------

Subtotal charges this section 3234.67

009	GEARBOX OILS						
	D CHANGE ROTOR GEARBOX OILS (1). CHANGE BOTH UNLOADING AUGER GEAR BOX OILS(0.75). CHANGE BUBBLE UP GEARBOX OIL(0.5)TOP UP LEVELS ON ALL OTHER GEARBOXS						
	F JR-TOPPED UP TRANSMISSION OIL PUT IN 1 L OF 80/90						
	DZ- DRAINED THE OIL FROM THE ROTOR GEARBOX, BOTH UNLOADING GEARBOX AND BUBBLE UP GEARBOX						
	PUT OIL INTO THE ROTOR GEARBOX, BOTH UNLOADING GEARBOX AND BUBBLE UP GEARBOX						
CLAB	L CUSTOMER LABOUR						310.50
	P 86557412 PLUG	1.00				6.79	6.79
	P B80903 80W90 9.46	1.00				67.38	67.38
	P OIL CONTAINER CHARGE EHC6	1.00				0.95	0.95
	Subtotal charges this section						385.62


010	AC BELT						
	D REPLACE AC DRIVE BELT. IT IS STARTING TO COME APART (1.5)						
	F JR-IN ORDER TO REPLACE AC BELT HAD TO REMOVED ENGINE FAN DRIVE BELT AND ROTARY SCREEN DRIVE BELT.						
	-REPLACED AC BELT						
	-REINSTALLED FAN AND SCREEN DRIVE BELT						
	-TIGHTENED ALL BELT TO ITS SPEC						
	FIXED AND VERIFIED						
CLAB	L CUSTOMER LABOUR						207.00
	P 84238514 BELT	1.00				25.03	25.03
	Subtotal charges this section						232.03

011	SHOE DRIVE ARM						
	D REPAIR SEIZED BUSHING ON ARM THAT TENSIONS THE SHOE DRIVE BELT(1)						
	F JB						
	PROBLEM WAS SHOE DRIVE IDLER ARM WAS SEIZED						
	-TRIED GREASING (WOULDN'T TAKE GREASE)						
	-REMOVED SHOE DRIVE BELT/PULLEY						
	-REMOVED RETURNS BELTS/SLIP CLUTCH						
	-REMOVED SHOE DRIVE ARM						
CLAB	L CUSTOMER LABOUR						138.00
	P 84056770 SLEEVE	1.00				83.88	83.88
	Subtotal charges this section						221.88

012	RETURNS						
	D REPLACE WORN RETURN PADDLES AT THE TOP OF THE AUGERS(0.5)						
	REPLACE WORN OUT RETHRASHERS DRUMS ON BOTH SIDES (7)						
	F REMOVE AND REPLACE TOP PADDLES ON RETURN AUGERS, FIXED AND VERIFIED, G.S. REMOVE LEFT AND RIGHT RETRESHERS FROM THE RETURNS, REMOVE PULLEYS , BELTS, REMOVE BEARINGS. PRESS OUT						



 WEBB'S MACHINERY (VEGREVILLE) LTD.
5342 - 50th Ave.
VEGREVILLE, AB T9C-1M3
Tel: 780-632-6772 Fax: 780-632-3223



RO: 8898B
Invoice: 14385B
Date: 09/05/2016

SWARE VENTURES INC.
C/O DON SWARE
R.R. 4
TOFIELD, AB T0B 4J0


Year		Make/Model		Serial Number		
2007		NH CR9070		HAJ110196		
Stock No	PO	Misc Information	Tag	Customer	Telephone	
3467				01148	780-662-3080	

Cond	OpCode	T	Description	Quantity	List	Net	Total
			BEARINGS FROM HOUSINGS. CLEAN UP SHAFTS ON AUGERS, REMOVE OLD KEYS, INSTALL NEW KEYS. INSTALL NEW BEARINGS IN HOUSINGS, INSTALL NEW RETRESHERS, INSTALL PULLEYS, INSTALL BELTS, INSTALL COVERS, TIGHTEN AND ADJUST BELTS. INSTALL RETHRESHER DOORS, AND PINS. INSTALL NEW DRIVE PULLEY AND KEY ON THE RIGHTSIDE RETHRESHER DRIVE. CLEAN AND INSTALL BOTTOM AUGER. CLEAN OUT SHIELDS AND PINS. FIXED AND VERIFIED, G.S.				
	CLAB		L CUSTOMER LABOUR				1035.00
			P 9838317 DEFLECTOR	1.00		102.58	102.58
			P 84607287 BEATER	1.00		520.02	520.02
			P 84607291 BEATER	1.00		520.02	520.02
			P 9838316 DEFLECTOR	1.00		100.10	100.10
			P 9837532 DEFLECTOR	2.00		44.83	89.66
			P 364908 BEARING	2.00		32.73	65.46
			P 323190 KEY	1.00		12.38	12.38
			P 75089 BRAKLEEN	1.00		5.75	5.75
			Subtotal charges this section				
013			GRAIN PAN SEAL				
			D REPLACE TORN GRAIN PAN SEAL IN THE FRONT RH CORNER(2)				
			F JR-REMOVED GRAIN PAIN SEAL				
			-ORDERED A NEW SEAL				
			-INSTALLED NEW SEAL AND 10 NEW BOLTS				
			FIXED AND VERIFIED				
	CLAB		L CUSTOMER LABOUR				276.00
			P 87376933 SEAL	1.00		50.60	50.60
			Subtotal charges this section				
014			YEILD SENSOR				
			D REPLACE WORN THRIUGH PLATE AT THE TOP OF THE GRAIN ELEVATOR AT THE YEILD SENSOR IT IS WORN THROUGH (0.5)				
	CLAB		L CUSTOMER LABOUR				69.00
			P 84441281 PLATE, WEA	1.00		470.80	470.80
			Subtotal charges this section				
015			ROTOR SHIFTER				
			D REPLACE MISSING BUSHING ON ROTOR GEARBOX SPEED SHIFTER (0.5)				
			F JR-REMOVED SHIFTER FROM GEARBOX INSTALLED NEW WASHERS AND A NEW CUTTER PIN				
			FIXED AND VERIFIED				
	CLAB		L CUSTOMER LABOUR				69.00
			Subtotal charges this section				
016			TORQUE SENSOR				
			D CUSTOMER COMPLAINT THAT ONE OF THE GREASE ZERKS BEHIND THE TORQUE SENSOR ON THE RAMPS DOESN'T TAKE GREASE.REPAIR				
			F INSPECT WHY GREASE ZERK WONT TAKE GREASE ON TORQUE HUB RAMP.				
			REMOVE ZERKS FROM BEARINGS, TRY TO FLUSH OUT OLD GREASE, AND				

REPRINT



 WEBB'S MACHINERY (VEGREVILLE) LTD.
5342 - 50th Ave.
VEGREVILLE, AB T9C-1M3
Tel: 780-632-6772 Fax: 780-632-3223



RO: 8898B

Invoice: 14385B

Date: 09/05/2016

SWARE VENTURES INC.
C/O DON SWARE
R.R. 4
TOFIELD, AB T0B 4J0

Year		Make/Model		Serial Number	
2007		NH CR9070		HAJ110196	
Stock No	PO	Misc Information	Tag	Customer	Telephone
3467				01148	780-662-3080

Cond	OpCode	T	Description	Quantity	Unit	Net	Total
TRY TO GREASE BEARINGS AGAIN. TRIED SEVERAL TIMES, THIS DID NOT WORK. REMOVE ROTOR DRIVE TORQUE HUB FROM COMBINE, CLEAN ASSEMBLY AND DISSEMBLE HUB. FOUND BEARINGS TO BE DAMAGED, AND RAMP TO BE WORN OUT IN SEVERAL AREAS. CONTACT CUSTOMER WITH REPAIRS NEEDED, DON SAID TO REPAIR THE ASSEMBLY. ORDER PARTS NEEDED FOR REPAIRS, CLEAN PULLEYS AND HUB, INSTALL NEW ROLLER BEARINGS, INSTALL NEW RAMP AND BUSHINGS.JR-HELPED GS							
	CLAB		L CUSTOMER LABOUR				690.00
			P 86582880 ROLLER	2.00		76.18	152.36
			P 86582882 SPRING	1.00		415.80	415.80
			P 87521324 CAM	1.00		671.65	671.65
			P 86576283 BUSHING	2.00		10.52	21.04
			P 87011453 SCREW, HEX	2.00		17.33	34.66
			Subtotal charges this section				1985.51
017			FEEDER FACE PLATE				
			D REPLACE BOTH LH AND RH CORNER SHEILDS THEY ARE BOTH WORN OUT.(0.5)				
			F REMOVE WORN OUT FEEDER SHIELD CORNERS, INSTALL NEW SHIELDS WITH NEW BOLTS, FIXED AND VERIFIED, G.S.				
	CLAB		L CUSTOMER LABOUR				69.00
			P 87696891 DEFLECTOR	1.00		73.70	73.70
			P 87696894 DEFLECTOR	1.00		54.45	54.45
			Subtotal charges this section				197.15
018			ROTOR VARIATOR				
			D REPAIR LEAK AT ROTOR VARIATOR THIS MAYBE THE SWIVEL UNION AND IT MAY BE FURTHER IN ON THE CYLINDER PART OF IT. (0.5)				
	CLAB		L CUSTOMER LABOUR				69.00
			P 84231982 COUPLING	1.00		460.10	460.10
			Subtotal charges this section				529.10
019			HEADER				
			D RESEAL HYD DRIVE MOTOR ON PICKUP DRIVE (1.5) REPLACE BROKEN AUGER FINGER AND HOLDER (1.5) STRAIGHTIN DENT IN AUGER (0.5)				
			F JR-RESEALED PICKUP DRIVE MOTOR				
			-REPLACED BROKEN HOLDER, FINGER, AND GUIDE				
			-HAD TO REMOVED 5 HOLDERS IN ORDER TO GET OUT BROKEN HOLDER				
			-STRAIGHTENED DENT ON TUBE				
			-INSPECT HEADER DRIVE ASSEMBLY , FOUND BEARING LOCK COLLARS TO BE LOOSE, FOUND ONE BEARING DAMAGED.				
			-REMOVE ASSEMBLY FROM HEADER, DISASSEMBLE ON BENCH. NEED NEW BEARINGS AND NEW DRIVE SHAFT, ORDER NEW PARTS, INSTALL NEW BEARINGS ON SHAFT. INSTALL IN HOUSING, INSTALL SPROCKET AND WASHERS, INSTALL SHAFT ON HEADER, INSTALL CHAIN, INSTALL DRIVE SHAFT AND SAFETY SHIELDS. ADJUST CHAIN , TIGHTEN HOUSING IN PLACE. FIXED AND VERIFIED, G.S.				

 
web_servicing1 template

REPRINT

page 6 of 8



WEBB'S MACHINERY (VEGREVILLE) LTD.
5342 - 50th Ave.
VEGREVILLE, AB T9C-1M3
Tel: 780-632-6772 Fax: 780-632-3223



RO: 8898B
Invoice: 14385B
Date: 09/05/2016

SWARE VENTURES INC.
C/O DON SWARE
R.R. 4
TOFIELD, AB T0B 4J0

Year		Make/Model		Serial Number		
		2007 NH CR9070		HAJ110196		
Stock No	PO	Misc Information	Tag	Customer	Telephone	
3467				01148	780-662-3080	

Band	OpCode	T	Description	Quantity	Ust	Net	Total
	CLAB		L CUSTOMER LABOUR				276.00
			P 84194057 FINGER 790	1.00		29.15	29.15
			P 84362468 JOINT	1.00		26.13	26.13
			P 374042A1 FINGER	1.00		27.23	27.23
			P 185309A1 SPLIT PIN/	1.00		5.92	5.92
			P 374177A1 GUIDE	2.00		5.75	11.50
			P PMF182051 HOLDER-AUG	1.00		10.74	10.74
			P PMF184684 NUT M6X1 A	3.00		1.55	4.65
			P 86989897 HEAD	1.00		412.50	412.50
			P 374129A1 BEARING, B	2.00		87.73	175.46
			Subtotal charges this section				979.28
020			LIGHTS				
			D TOP ENGINE WORK LIGHT MISSING BULB, BACK RH LIGHT NOT WORKING,				
			SEIVE WORK LIGHT NOT WORKING,				
	CLAB		L CUSTOMER LABOUR				
			Subtotal charges this section				
021			CHAINS				
			D REPLACE UNLOADING AUGER DRIVE CHAIN, BUBBLE UP DRIVE CHAIN, THE				
			TOP CLEAN GRAIN ELEVATOR DRIVE CHAIN THE CUSTOMER IS GOING TO				
			BRING IN HIS OWN CHAIN FOR THIS ONE AND WE HAVE TO MAKE SURE				
			THIS CHAIN IS 2 LINKS SHORTER THEN FACTORY HE WANTS IT EXACTLY				
			THE SAME LENGTH AS WHAT IS ON THERE NOW.				
			F CUSTOMER BROUGHT IN HIS OWN CHAINS, MEASURE AND CUT CHAINS TO				
			LENGTH. REPLACE UNLOADING DRIVE CHAIN, REPLACE INSIDE ELEVATOR				
			DRIVE CHAIN, FIXED AND VERIFIED. G.S.				
	CLAB		L CUSTOMER LABOUR				138.00
			P 50-1R # 50 CHAIN	4.00		8.17	32.68
			P 50-1RCONN # 50 CONNE	1.00		3.68	3.68
			Subtotal charges this section				174.36
022			CLEAN				
			D CLEAN CAB				
			F CLEAN UNIT AT NO CHARGE TO CUSTOMER				
	CLAB		L CUSTOMER LABOUR				
			Subtotal charges this section				
	M		SHOP SUPPLIES				300.00

REPRINT

page 7 of 8

page 8 of 8