Sware Ventures Ship to: Invoice to: DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5 INVOICE

CAMROSE 4149 39 Street

Camrose, AB T4V 3X8 (780) 672-9136 Fax:

(780) 672-4582 Toll Free: 1-855-763-1427

Branch	- HERON CONTRACTOR OF THE STATE	***************************************	<del>areas and and and and and and and and and and</del>	>
CAMROSE		WANTED TO THE PARTY OF THE PART		
Date	Time			Page
02/12/18	13:	38:44 (	0)	01
Account No.	Phone N	Ο.		Reference No.
SWARE005	780	6623080		W12291
Ship Via		Purchase	Order	
	Water the state of	G.S.T. No.		Herrit Wallander Commencer
		825 72	24 03	32 RT0001
Credit Card No.		P(1)	Sale	sperson
			6	82

### **Description of Work and Parts**

STK#/FLEET#

117859

Combine CR9070

HRS PIN/EIN

01/11/18 01/11/18

2644 HAJ110196

1672

WARRANTY DATE

CONTINUED ON PAGE 02

HRS

Fold - -

SEGMENT# 1 C 00770 NA

Check and inspect rotors

CORRECTION:

Unhook electrical and hydraulics from feeder house. Remove shields, Remove drive belt from LH side. Use forklift to remove feeder house from combine. Set feeder house on stands in shop to be re-built. Secure rotors in combine with straps. Remove rotor bearing lock collars, remove front rotor bearing plate. Use forklift and rotor removal tool to remove both rotors from combine. Once rotors were on the floor found that both of them had a lot of material built up inside. Rigged up shop vaccum house in back end of rotor and used a long blow gun from the front to get dust air borne and allow the vaccum to suck it out of the tube, was had to get material out due to the baffles inside the rotor tubes. once the inside of the tubes were tube, install shafts onto rotor to set on balance stand. Clean all debris out from behind rub bars on both rotors, I got the LH rotor very close to balanced and then noticed that that rub bar mounts were cracking and pulling out of the tube, The RH rotor, had more severe dents and i could not get the rotor to balance. Make parts quote and discuss with customer

FREIGHT FREIGHT 2 17.00 34.00 84591415 ROTOR 10 8255.28 8255.28 84591418 ROTOR 1 0 7859.90 7859.90 PARTS 16149.18 LABOR 2357.64 13300028 SEGMENT TOTAL ==> 18506.82

I hereby authorize the above work to be done along with the use of necessary materials. You and you above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on deliver satisfactory with you and until paid in full, an express mechanic's lien is acknowledged on above mach of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by placed with them for storage, sale, repair or while being tested. Estimates are for labour only, material					
(signature)	(date)	(signature)	(date)		



Sware Ventures Ship to: 9 DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5

**CAMROSE** INVOICE 4149 39 Street

Camrose, AB T4V 3X8 (780) 672-9136 Fax: (780) 672-4582 Toll Free: 1-855-763-1427

Branch	Manuscon and the second	W			THEOREM SAMESTAN
CAMROSE					
Date	Time		A THE SAME	**************************************	Page
02/12/18	13;	38:44 (	0)		02
Account No.	Phone N	0.		Refe	rence No.
SWARE005	780	6623080		W12	291
Ship Via		Purchase	Order		
	TTTAVATION (ENTITED AND AND AND AND AND AND AND AND AND AN				
		G.S.T. No.			
		825 72	24 03	32 R	T0001
Credit Card No.			Sale	sperso	on
			6	82	

#### **Description of Work and Parts** STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS Fold - -117859 Combine 2644 HAJ110196 CR9070 1672 SEGMENT# 2 C 00770 NA 01/11/18 01/11/18 Replace bubble-up drive chain .50 HRS CORRECTION: Remove and replace bubble up auger drive chain and adjust tension B504966 CHN CONN 50 4.08 4.08 1740DDX 50# chain 100' 3 8.40 25.20 PARTS 29.28 LABOR 24.12 13300028 SEGMENT TOTAL ==> 53.40 SEGMENT# 3 C 00770 NA 01/11/18 01/11/18 Replace grain elevator drive chain .50 HRS CORRECTION: Remove and replace clean grain elevator drive chain, B504980 60H CONN LINK 1 4.38 4.38 B91542DX 60H# chain 50' 6 11.55 69.30 PARTS 73.68 LABOR 57.62 13300028 SEGMENT TOTAL ==> 131.30

SEGMENT# 4 C 00770 NA

01/11/18 01/11/18

Repair RH tailings drum (loose)

8.00 HRS

#### CORRECTION:

-remove shield and belt from RH side of tailings shaft, Remove belts from LH side. Use pullers to remove pulley, belt tensioner arm, and bearings from shaft. Dis-assemble housing, remove snap ring and shim washers, remove tailings drum from shaft. Found key to be really worn. Clean up key

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full, an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional.	I have been a standard and a standar
(signature) (date)	(signature) (date)

Sware Ventures

O DON SWARE

52429 RGE RD 183

BEAVER COUNTY AB TOB 4J5

CAMROSE 4149 39 Street Camrose, AB T4V 3X8

Tel: (780) 672-9136 Fax: (780) 672-4582 Toll Free: 1-855-763-1427

Branch				The state of the s
CAMROSE				
Date	Time	MARINE CONTRACTOR	**************************************	Page
02/12/18	13:3	8:44	(0)	0 3
Account No.	Phone No	ο.		Reference No.
SWARE005	7806	62308	0	W12291
Ship Via		Purchas	se Order	
		G.S.T. N	lo.	
		825	724 03	32 RT0001
Credit Card No.	ANAIHIAI		Sale	sperson
			6	82

### **Description of Work and Parts**

S	T	K	#	/	F	L	E	E	T	#	

117859

Combine CR9070

HRS PIN/EIN 2644 HAJ110196

WARRANTY DATE

HRS

Fold - -

INVOICE

1672

way and shaft. Installed a new key into key- way and test fit drum, Drum now fits tight on the shaft and key-way. Remove Drum from shaft. Clean mud and debris from housing. Install shim washers then drum check for alignment in the housing, install shim washers between housing and snap ring to take up access space. Install snap ring. Install housing and secure with mount bolts. Install new bearing and flanges on RH side. Install tensioner arm, pulley and snap ring that retains it all on the shaft. Remove the spiked doors and clean mud out of doors. Install spiked doors into position and adjust clearances on spiked doors. Install RH tailings belts and LH tailings belts

ZED220010	SEAL	1	5.03	5.03
170008	KEY	1	5.87	5.87
322357	LOCKWASHER	4	1.25	5.00
323190	KEY	1	12.32	12.32
364908	BEARING	1	32.47	32.47
444104	COVER	1	20.00	20.00
444105	COVER FLANGE	1	23.13	23.13
86500688	NUT	2	.10	.20
86508568	CAP SCREW	2	. 39	.78
87022926	WASHER	2	2.60	5.20
9511041	HOUSING	1	21.56	21.56
			PARTS	131.56
			LABOR	1062.62
13300028		SEGMENT	TOTAL==>	1194.18

SEGMENT# 5 C 00770 NA

01/11/18 01/11/18

Replace feeder drive chains (2)

1.00 HRS

CORRECTION:

I hereby authorize the above work to be done along with the use of necessary materials. You and your above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cash on deliver astistactory with you and until paid in full, an express mechanic's lien is acknowledged on above machin of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by the placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials.	y of machine or on terms ne to secure the amount helt or fire to machine	I hereby acknowledge my indebtedness in the amount of \$ amount owing or balance owing as shown hereon.	being the total
(signature)	(date)	(signature)	(date)



CAMROSE 4149 39 Street INVOICE

4149 39 Street Camrose, AB T4V 3X8 Tel: (780) 672-9136 Fax: (780) 672-4582 Toll Free: 1-855-763-1427

Branch			
CAMROSE			
Date	Time		Page
02/12/18	13:38:4	4 (0)	04
Account No.	Phone No.	F	Reference No.
SWARE005	7806623		12291
Ship Via	Purc	hase Order	
	G.S.	. No.	
	83	25 724 032	RT0001
Credit Card No.	***************************************	Salesp	erson

				AMANANA TO THE TOTAL THE TAXABLE PROPERTY OF TAXABLE PROPE	1 682
		Description of W	ork and F	T T T T T T T T T T T T T T T T T T T	AND
And the second s	Annual Control of the	Description of W	ork and F	ars	
STK#/FLEET	#	HRS PIN/EIN	WADDA	NTY DATE HRS	
117859	Combine	2644 HAJ110196	HARCO	WII DAID NKO	Foks -
	CR9070	1672			
Remove an	d replace feeder	drive chains, adjust cha	in		
tension w	ith idlers and ti	ghten hardware			
ADDITIONA	L DESCRIPTION:				
- RH side					
B504991		80H CONN LINK	4	6.33	25.32
1132181R1	X	80H CHAIN	32	33.58	1074.56
				PARTS	1099.88
				LABOR	125.96
13300028			SEGMENT	TOTAL ==>	1225.84
SEGMENT# 6	C 00770 NA	01/11/10 01/11/10	· · · · · · · · · · · · · · · · · · ·	and the second s	- The second sec
	eeder drive idler	01/11/18 01/11/18			
CORRECTIO		. Share & brgs.		4.00 HRS	
Approximate	****	of feeder house, use grin	day to		
clean bur	rs off shaft ren	nove shaft from bracket a	der to		
		ngs and flanges onto mou			
		: into bearings with new			
		of shaft and lock collar			
		install new key into sh			
		in position with new set			
		of feeder house and se			
mount har					
100016		NUT	2	. 63	1.26
393599		SCREW	2	11.75	23.50
47508396		COLLAR	2	17.92	35.84
84172925		SHAFT	1.	66.99	66.99
84484181		BEARING	2	38.30	76.60
86629541		BOLT	1	1.44	1.44
86974088		FLANGE	4 0	11.76	47.04
87038548		KEY, WOODRUFF	1	2.44	2.44
			CONTI	NUED ON PAGE 05	
84484181 86629541 86974088		BEARING BOLT FLANGE	2 1 4 0 1	38.30 1.44 11.76 2.44	

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may above machine for purposes of testing, inspection or delivery at my risk. I agrise to pay cash on delivery of machine or satisfactory with you and until paid in full, an express mechanic's lien is acknowledged on above machine to secure the of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by theft or fire to ma placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional.	in terms amount if hereby acknowledge my indebtedness in the amount of \$
(signature) (date)	(signature) (date)



Sware Ventures Ship to: nvoice to: DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5

#### CAMROSE INVOICE

4149 39 Street Camrose, AB T4V 3X8

(780) 672-9136 (780) 672-4582

Toll Free: 1-855-763-1427

Branch	Wow				<u> </u>
CAMROSE					
Date	Time	ANT CONTROL OF THE PARTY OF THE		HILDRAN MANUFACTURE	Page
02/12/18	13:	38:44 (	0)		0.5
Account No.	Phone N	0.		Refe	rence No.
SWARE005	780	5623080		W12	291
Ship Via		Purchase	Order		
	TAYLLIa triorum cumppopalatanas				
		G.S.T. No.			***************************************
	rdebours - somouth transit	825 72	***		
Credit Card No.			Sale	sperso	חח
			6	82	

255.11

533.32

788.43

#### **Description of Work and Parts** HRS PIN/EIN WARRANTY DATE HRS Fold -2644 HAJ110196 1672

PARTS

LABOR

3.00 HRS

13300028 SEGMENT TOTAL ==> SEGMENT# 7 C 00770 NA

R&R upper sieve

01/11/18 01/11/18

CORRECTION:

STK#/FLEET#

117859

Remove upper LH sieve that was missing slats in sieve. Remove upper RH sieve to replace ripped rubber curtain. While swapping brackets to new sieve found that curtain on the LH seive was ripped also replaced curtain, Check lower sieve opening and calibrate. Remove sieve actuator arms and re-configure so they will hook to sieve when installed in lower position. Install sieves into combine. Adjust upper sieves so they are the same side to side and calibrate. ADDITIONAL DESCRIPTION:

-	replace	curtain	on	RH	sieve
---	---------	---------	----	----	-------

Combine

CR9070

LUPLUU CULUULU CII	2 C X 4 C X X X X X X X X X X X X X X X X			
FREIGHT	FREIGHT	1	17.00	17.00
47389898	SIEVE	1	909.50	909.50
563733	COLLAR	2	26.60	53.20
743083	CANVAS	2 M	172.48	344.96
766379	SPROCKET	2	209.43	418.86
766380	SPROCKET	1	231.66	231.66
86509499	NUT	6	.83	4.98
88274	SET SCREW	6	5.55	33.30
*			PARTS	2013.46
			LABOR	435.14
13300028		SEGMENT	TOTAL ==>	2448.60

SEGMENT# 8 C 00770 NA

01/11/18 01/11/18

It hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms sestification with you and until paid in full, an express mechanic's ten is acknowledged on above machine to secure the amount of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by their or fire to machine placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional.	If however, and the second of
(signature) (date)	(signature) (date)

Sware Ventures Ship to: nvoice to: DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5 INVOICE

**CAMROSE** 4149 39 Street

Camrose, AB T4V 3X8 (780) 672-9136 Fax: (780) 672-4582

Toll Free: 1-855-763-1427

Branch				-	
CAMROSE					
Date	Time				Page
02/12/18	13:	38:44 (	0)		06
Account No.	Phone N	0.			rence No.
SWARE005	780	6623080		W12	291
Ship Via		Purchase	Order	•	
		G.S.T. No.			
		825 7	24 03	32 R	Γ0001
Credit Card No.			Sale	sperso	on
			6	82	

HRS

### **Description of Work and Parts**

STK#/FLEET#

117859

Combine CR9070

HRS PIN/EIN

2644 HAJ110196

1672

Replace Rotor drive variator union

CORRECTION:

remove and replace rotor variator union. Clean up oily mess, re attach supply hydraulic line, secure in place with bolts

84231982

ROTATOR UNION

420.00 PARTS 420.00

Fold - -

13300028

SEGMENT TOTAL ==>

420.00

WARRANTY DATE

420.00

SEGMENT# 9 C 00770 NA

01/11/18 01/11/18

Repair feeder

CORRECTION:

10.00 HRS

1.50 HRS

Remove shields from around front drum, Release tension from feeder chain, Remove connector links, Remove feeder chain from feeder house. Remove anti-wrap shields, and remove bearings from top shaft, remove sprockets from top shaft. Clean up shaft, install new sprockets onto shaft. Remove and replace bearings for top shaft in housings, install bearings onto top shaft, install new lock collars. Remove front drum and replaced from drum bearings, they were really dry and rough sounding. Install front drum back into feeder and lower drum stops into position #2, install new feeder chain and align sprockets on top shaft. Use new set screws to lock sprockets into position. Install anti-wrap shields using new hardware. install connector links in new feeder chain, set chain tension to spring quage. Install shields on front of feeder above drum. Install new spring that customer supplied for feeder slip clutch ADDITIONAL DESCRIPTION:

- replace bearings and top sprockets

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may ope above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on its satisfactory with you and until paid in full, an express mechanic's lien is acknowledged on above machine to secure the am of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by their or fire to machine placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional.	ms bunk I hereby acknowledge my indebtedness in the amount of \$ being the total
(signature) (date)	(signature) (date)

Sware Ventures Ship to: nvoice to: DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5 CAMROSE 4149 39 Street Camrose, AB T4V 3X8 (780) 672-9136

(780) 672-4582 Toll Free: 1-855-763-1427

Fax

Branch	VIII COMMON COMM		- Andrews	AND THE RESIDENCE OF THE PARTY
CAMROSE				
Date	Time	The state of the s		Page
02/12/18	13:	38:44 (	0)	0.7
Account No.	Phone N	Ο,		Reference No.
SWARE005	780	6623080		W12291
Ship Via		Purchase	Order	
		G.S.T. No.		A STATE OF THE STA
		825 7	24 03	2 RT0001
Credit Card No.			Sales	sperson
			6	82

INVOICE

### **Description of Work and Parts**

STK#/FLEET#		HRS	PIN/EIN	S.I.N. T. T	ANIMA DAME	*****	
117859	Combine	2644	HAJ110196	MARN	RANTY DATE	HRS	Fold
- chain rolle	CR9070 ers worn excessive	1672	1110190				
140046		LOCKWASI	HER	10	1.10		11.00
337475		HEX NUT		10	.46		4.60
353308		NUT, LO	CK, M6	4	.34		1.36
412649		WASHER,	LOCK	1	1.70		1.70
7120024		SCREW		1	1.60		1.60
84057307 84462522		BEARING		2	89.38		178.76
86512439		SHIELD		1 0	84.24		84.24
86553833		SCREW		4	2.88		11.52
86629542		SCREW		10	14.25		142.50
87297793		NUT		1	.37		.37
87372057		PACKAGE		2	110.16		220.32
88540		CR970 FD		1 0	2801.60		2801.60
00010		CAP SCRE	iw .	20	2.13		42.60
					PARTS		3502.17
13300028				SEGMENT	LABOR TOTAL==>		1372.16 4874.33

SEGMENT#10 C 00770 NA

01/11/18 01/11/18

Reverser motor gear loose

CORRECTION:

Remove hydraulic lines from reverser motor. Remove shields on RH side of feeder, Remove mount bolts for motor, Remove motor found gear retaining bolt broke off in shaft, use LH

drill bit and drill bolt, bolt threaded out, install new bolt and washers, loctite bolt and tighten in place.

Install motor back onto feeder and secure mount bolts.

Re-attach hydraulic lines. Install shields

322358

LOCKWASHER, M8

43127

SCREW, CAP

1 .13 .89

.13 .89

CONTINUED ON PAGE 08

hereby acknowledge my indebtedness in the amount of \$\_

3.00 HRS

hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full, an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional.

amount owing or balance owing as shown hereon.

(signature)

(date)

(signature)

(date)



Rocky Mountain Equipment Canada Ltd. o/a Rocky Mountain Equipment Sware Ventures Invoice to: DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5

CAMROSE 4149 39 Street Camrose, AB T4V 3X8 Tel (780) 672-9136 (780) 672-4582

Toll Free: 1-855-763-1427

INVOICE

Branch	State of the state			
CAMROSE Date				
	Time	Mary Mary Mary Mary Mary Mary Mary Mary	***************************************	Page
02/12/18 Account No.	Phone N	38:44 (	(0)	08
SWARE005		6623080		Reference No.
Ship Via		Purchase	Order	W12291
		G.S.T. No.		
Credit Card No.		825 7	24 03	2 RT0001
Order Card No.			Sales	sperson
		····	6	82

# **Description of Work and Parts**

CONTAIL /mm				THE RESERVE TO THE RE			
STK#/FLEET# 117859	Combine	HRS 2644	PIN/EIN HAJ110196	WARRAN	ITY DATE	HRS	44 20
9507949	CR9070	1672 WASHER	120110196	7 NT			र केल्किक वस 30
				1 N	13.13		13.13
					PARTS		14.15
13300028				CECMENT OF	LABOR		379.22
				SEGMENT T	OTAL==>		393.37
SEGMENT#11 C	00770 NA	01/11/1	8 01/11/10			(4774	

600 hr. service

01/11/18 01/11/18

12.00 HRS

CORRECTION:

performed 600 hr service, changed oils in transmission, final drives, bubble up auger gearbox, unloading auger gearbox, Changed engine oil and filter, changed fuel filters, changed hydraulic oil and filter. Remove and replace engine crankcase filter. Changed engine gearbox oil, Start unit and run, verify levels after they had time to settle, Grease unit

Pengna			
B80904 FF5471 FIL1 FIL2 HF6555 LF3977 OIL1 2996234 504153481 73341700 73341701 73341702 73341774 84348883	FLUID FILTER, FUEL ENVIRO FILT<8" ENVIR FILT>8" FILTER FILTER, ENGINE ENVIRO OIL LTR GASKET FILTER, BREATHER 15/40 CJ4ENG 1G 15/40 CJ4ENG 5G MTRAN ULTRA 5G FILTER, FUEL	2 122.00 1 60.02 2 .50 6 1.00 3 69.51 2 73.06 229 .10 2 25.29 1 76.03 1 24.00 1 55.75 1 102.00 5 99.40 1 46.48	244.00 60.02 1.00 6.00 208.53 146.12 22.90 50.58 76.03 24.00 55.75 102.00 497.00 46.48
		PARTS CONTINUED ON PAGE 00	1540.41

Description of the second of t	
I hereby authorize the above work to be done along with the use of necessary materials. You and your employees above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine statisfactors, with your and until load in the statisfactors.	
of repairs thereto. It is understood that the company assumes no responsibility for loss of devices the company assumes no responsibility for loss of devices the company assumes no responsibility for loss of devices the company assumes no responsibility for loss of devices the company assumes no responsibility for loss of devices the company assumes no responsibility for loss of devices the company assumes no responsibility for loss of devices the company assumes no responsibility for loss of devices the company assumes no responsibility for loss of devices the company assumes no responsibility for loss of devices the company assumes no responsibility for loss of devices the company assumes no responsibility for loss of the company as t	e the amount
placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional	

	I hereby acknowledge my indebtedness in the amount of \$
The state of the s	(signature) (date)



Rocky Mountain Equipment Canada Ltd. o/a Rocky Mountain Equipment Sware Ventures Ship to: Invoice to: DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5

CAMROSE 4149 39 Street Camrose, AB T4V 3X8 Tel: (780) 672-9136 Fax: (780) 672-4582

Toll Free: 1-855-763-1427

INVOICE

Branch		And the second s
CAMROSE		
Date	Time	Page
02/12/18	13:38:44	(0)
Account No.	Phone No.	Reference No
SWARE005	7806623086	0 W12291
Ship Via	Purchase	e Order
	G.S.T. No	0.
	825	724 032 RT0001
Credit Card No.		Salesperson
		682

L			1 1			Carcaperson
	The second secon	The state of the s				682
And the second s	And the second statement of the statement of the second statement of the secon	Dogorintia			· · · · · · · · · · · · · · · · · · ·	
The state of the s	THE OF THE CONTRACT OF THE CON	Description of V	Vork and	Parts		
STK#/FLEET: 117859	# Combine CR9070	HRS PIN/EIN 2644 HAJ110196 1672	WARI	RANTY DATE	HRS	Fold -
13300028			SEGMENT	LABOR TOTAL==>		1557.08 3097.49
Check rota CORRECTION Remove rota inner bear remove drif feel good Re-install	tary screen drive ring and release jive belt. Spin sha and roll smooth.	01/11/18 01/29/18  belt, loosen mount bolack shaft drive belt to the check bearings, they also make no noise tension on jack shaft	bearings	2.00	HRS	
13300028			SEGMENT	LABOR TOTAL==>		77.72 77.72
Replace pi CORRECTION Remove shi motor, Rem	eld from over bel ove belt, Install for motor 1 was	01/11/18 01/11/18  t, remove hydraulic li   new belt, install 2 broke off. install shi	new bolts	1.00	HRS	
337505 87372654		BOLT BELT	1	12.88 9.00 34.72 PARTS LABOR		12.88 9.00 34.72 56.60
13300028			SEGMENT	TOTAL==>		138.02 194.62
EGMENT#14 (	C 00770 NA	01/11/18 01/11/18	**************************************	The state of the s		West and the second

S

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk, I agree to pay cosh on delivery of machine or on terms satisfactory with you and until paid in full, an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional.	I hereby acknowledge my indebtedness in the amount of \$ being the total amount owing or balance owing as shown hereon.
(signature) (date)	(signature) (date)



STK#/FLEET#

(signature)

Rocky Mountain Equipment Canada Ltd. o/a Rocky Mountain Equipment Sware Ventures Ship to: Invoice to: DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5

I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full, an express mechanic's lien is admovinedged on above machine to secure the amount of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional

CAMROSE 4149 39 Street

Camrose, AB T4V 3X8 (780) 672-9136 Fax: (780) 672-4582 Toll Free: 1-855-763-1427

I hereby acknowledge my indebtedness in the amount of §\_ amount owing or balance owing as shown hereon.

(date)

(signature)

(date)

INVOICE

Branch	Militanijesees (1940) Mangdong (1940) ee		SACATTOWN P. PARAMETERS	
CAMROSE Date				
	Time		No. No. of Concession, Name of	Page
02/12/18 Account No.	13:3	38:44 (	0)	7.0
	Phone N	0,		Reference No.
SWARE005 Ship Via	<u> </u>	623080		W12291
Strip Via		Purchase	Order	The second secon
Control of the second s				
		G.S.T. No.		- Water Charles
Credit Card No.		825 7		32 RT0001
Credit Card No.			Sale	sperson
			6	82

## **Description of Work and Parts**

		HRS	DIM / DIM					
117859	Combine		PIN/EIN	WARI	RANTY	DATE	HRS	P
	CR9070	2644	HAJ110196					Fold ~
Replace LH	front tunnel	1672						
CORRECTION:	rrone cunner					3.00	unc	
Removed in						3.00	nko	
hand	spection covers insi	de grain	tank. Remo	ved.				
	- Cit Cuillie Rane	the hear	3 1 1					
possible.	Removed tunnel and	. the band	n back as go	od as				
silicone.	Installed now to	creaned (	off all the	remaining	r			
	PPIICONA FA	277						
	rain tank inspection	n covers						
ADDITIONAL.	DESCRIPTION:							
- LH & KH Y	otors are dented							
86974430		COVER		10	0.0			
				+ 0		1.50		821.50
						ARTS		821.50
13300028				ana		ABOR		469.00
				SEGMENT	TOTA	L==>		1290.50
EGMENT#15 C	00770 NA	01/11/10	01/11/18		THE PERSON NAMED IN COLUMN	The state of the s	The state of the s	
	er drive chain	01/11/10	0 0 1 / 1 1 / 1 8					
CORRECTION:	The state of the s					.50	HRS	
	replace auger drive	abada						
tension tig	hten hardware.	Chain on	neader, set	chain				
B504980		5011 001n						
B91542DX		60H CONN		2		4.35		8.70
27134217		60H# cha	in 50'	14	1	1.42		159.88
					p.	ARTS		
						ABOR		168.58
13300028				SEGMENT				80.40
					1017	U- = >		248.98
EGMENT#16 C	00770 NA	01/11/18	01/11/18	The state of the s	MATERIA () SEERING MATERIAL SERVICE AND SE		the state of the s	
				CONT	INUED	ON PA	GF 11	



(signature)

Rocky Mountain Equipment Canada Ltd. o/a Rocky Mountain Equipment

to:	Sware Ventures
Ship	
Invoice to:	DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5

Branch	NATIONAL PROPERTY OF THE PROPE				
CAMROSE Date	Time	CONTRACTOR CONTRACTOR	натення	1	Page
02/12/18 Account No.	13:3 Phone N	38:44 (0	)	Refe	11 rence No.
SWARE005 Ship Via	7806	6623080   Purchase 0	)rder	W12	291
Crip Via	Nicht and a state of the state			MANAGEM NACTOR	
		G.S.T. No. 825 72	4 0	32 R	T0001
Credit Card No.	No.		Sale	spers	on
		all and a second	6	582	

I hereby acknowledge my indebtedness in the amount of \$\_ amount owing or balance owing as shown hereon.

(signature)

(date)

#### **Description of Work and Parts** STK#/FLEET# WARRANTY DATE HRS HRS PIN/EIN Fold - -117859 Combine HAJ110196 2644 CR9070 1672 .50 HRS Repair LH rear warning lamp CORRECTION: remove light assembly, remove and replace LH tail light bulb, re-install light assembly. Check for proper operation ADDITIONAL DESCRIPTION: - bulb burnt out 3.50 3.50 86537133 BULB 1 3.50 PARTS 60.30 **LABOR** 63.80 SEGMENT TOTAL ==> 13300028 01/11/18 01/11/18 SEGMENT#17 C 00770 NA 1.00 HRS R&R pick-up PTO drive sprocket CORRECTION: Remove nut and old sprocket, install new sprocket and check alignment, found it to be way out, moved shims around to get proper position, had to shim jack shaft mount to get it in true alignment. Install nut and cotter pin 33.39 SPROCKET ASSY. 1 M 33.39 378416A1 33.39 **PARTS** 115.24 LABOR SEGMENT TOTAL ==> 148.63 13300028 01/11/18 01/11/18 SEGMENT#18 C 00770 NA 1.50 HRS Replace RH shoe roller CORRECTION: Remove RH shoe roller assembly. Remove and replace roller. Install assembly back onto shoe. Adjust shoe roller position. Check operation of shoe pivot 47.30 47.30 ROLLER 434817 CONTINUED ON PAGE 12 I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full, an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional

(date)

Tel: Fax:

(780) 672-4582

Toll Free: 1-855-763-1427

52429 RGE RD 183

BEAVER COUNTY AB TOB 4J5

Rocky Mountain Equipment Canada Ltd. o/a Rocky Mountain Equipment

	Swar	e Ventu					West	
j								
	San in the							
ō	The state of the s							
		Market of the second se	and his booking or a supplementary to the supplemen	Windows Company	NAME OF THE OWNER, THE	WWW.	BAMANON in un accomulated de paparacions	- Administration of the second
ö		CMVDE	WITTE STATE OF THE	-	White the House Hill Colored	HITTANIA SANA	OVER 18 STATE OF THE PARTY OF T	

Branch					
CAMROSE	WOODS THE WAY	**************************************		EU-V-SONA MALEUN	
Date	Time				Page
02/12/18		38:44 (	)		12
Account No.	Phone No.		Reference No		
SWARE005	7806	6623080		W12291	
Ship Via		Purchase	Order	,	
		G.S.T. No.			
		825 72	24 0	32 R	T0001
Credit Card No.			Sale	spers	on
	*		(	82	

### **Description of Work and Parts**

Fax:

(780) 672-4582

Toll Free: 1-855-763-1427

STK#/FLEET# 117859	Combine CR9070	HRS 2644 1672	PIN/EIN HAJ110196	WARRANTY DATE	HRS	Fold	
				PARTS		47.30	
				LABOR		150.08	
13300028				SEGMENT TOTAL ==>		197.38	
SEGMENT#19	C 00770 NA	01/11/1	8 01/11/18		The state of the s	enginassa viving angula bilinin na minining angula sa	
Transmissio	on drain plug lea	ıking		.50	HRS		
				LABOR		2.68	
13300028				SEGMENT TOTAL ==>		2.68	

SEGMENT#20 C 00770 NA

nvoice

01/11/18 01/11/18

10.00 HRS

Overhaul grain elevator CORRECTION:

Locate connector link in elevator paddle chain and remove, remove paddle chain from elevator, Remove bearings from both sides of clean grain elevator to be able to slide auger over to get sprocket off the shaft, remove auger from combine, clean up both ends of the shaft. Install new sprocket, keyway, and roll pin the align sprocket. Install new bearings on both sides of auger, Old ones were really dry, align auger in position so sprocket is centered in elevator housing. Secure bearings with new lock collars. Remove drive sprocket from top of elevator head. Remove panel that covers the elevator head. Remove lock collars from both side of shaft, drive roll pin out of sprocket, drive shaft out of bearings, remove and replace bearings, Clean up shaft, slide shaft into position installing new sprocket, key, and roll pin. align sprocket in housing and lock lock collars. Install new drive sprocket old one had lots of cupping on teeth. Install new paddle chain, connect connector link and adjust chain tension. Adjust clearance

	I hereby acknowledge my indebtedness in the amount of \$
(signature) (date)	(signature) (date)

Sware Ventures Ship to: Invoice to: DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5

SE	INVOICE
Street	

CAMRO 414939 Camrose, AB T4V 3X8

(780) 672-9136 Tel: (780) 672-4582 Fax: Toll Free: 1-855-763-1427

9
No.
)1

### **Description of Work and Parts**

STK#/FLEET#	Combine	HRS 2644	PIN/EIN HAJ110196	WARR	ANTY DATE	HRS	Fold
-	CR9070 of paddle and top	1672 cover on	elevator.	Install			
shields.				_	2 20		6.24
333960		PIN, ROI	LL	2	3.12		12.20
354775		KEY		2 0	6.10		700.40
47949285		CHAIN, I		1	700.40		196.48
84437648		SPROCKE	r, DRIVE	2 1	98.24		
84442293		SPROCKE	r		186.03		186.03 71.67
87044350		BEARING	, BALL	1	71.67		
87605590		BEARING	, SPHERI	3	63.49		190.47
					PARTS		1363.49
					LABOR		1345.36
13300028				SEGMENT	TOTAL==>		2708.85
SEGMENT#21 C	00770 NA	01/11/1	8 01/11/18	And the latest state of the latest states and the latest states ar		AND THE PARTY OF T	And Andrew (1994) (1994
Repair choppe	er (parts only)						
- straight kr	nives (60)						
- bolts & nut	ts (30)						
NH412672		NUT LOC	K 12MX1.	30	1.88		56.40
412672		NUT		30-	1.88		56.40
87318316		Knife		60	23.13		1387.80
					PARTS		1387.80
13300028				SEGMENT	TOTAL==>		1387.80

SEGMENT#22 C 00770 NA

01/11/18 01/11/18

R&R beater block-off plate

2.00 HRS

CORRECTION:

Loosen beater pan hardware. Lower beater pan down to allow for installation of beater pan block-off plate. Install plate and secure hardware. Adjust pan to beater clearance

	I hereby acknowledge my indebtedness in the amount of \$i amount owing or balance owing as shown hereon.	being the total
	(signature) (date	8
(signature) (date)		***************************************

Sware Ventures Ship to: nvoice to: DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5

	N	V	O	1	C	E
--	---	---	---	---	---	---

CAMROSE 4149 39 Street Camrose, AB T4V 3X8

varmose,	SAFT 1 LA B COLLON
Tel:	(780) 672-9136
Fax	(780) 672-4582
Toll Free:	1-855-763-1427

Branch					
CAMROSE Date	Time	ro, co <del>mit de la c</del> ercana	projection in the Partie of th	Page	
02/12/18 Account No.	13:38 Phone No.	:44	(0)	Reference No.	
SWARE005 Ship Via	78066 F	W12291			
		O T 1			
	G.S.T. No. 825 724 032 RT0001				
Credit Card No.				sperson	
				582	

### **Description of Work and Parts**

STK#/FLEET 117859	Combine CR9070		PIN/EIN HAJ110196	WARR	ANTY DATE	HRS	Fold
to 3/8". 412650 87333878	Tighten beater pa	an mount hardw WASHER, DIA KIT	LOCK	8 1 N SEGMENT	1.30 525.30 PARTS LABOR TOTAL==>		10.40 525.30 535.70 218.42 754.12

SEGMENT#23 C 00770 NA

01/11/18 02/07/18

4.00 HRS

Raise steering axle

CORRECTION:

Use jack to lift rear axle on RH side, remove tire, use hoist to support spindle assembly, remove bolts from spindle assembly, use hoist to change position of spindle assembly raised it one position, install bolts into spindle with loctite, torque bolts to spec. Jack axle high enough to get tire back onto spindle, lower jack and torque rear wheel nuts, Repeat steps for LH side ADDITIONAL DESCRIPTION:

- move up one slot

LABOR

156.78

13300028

SEGMENT TOTAL ==>

156.78

SEGMENT#24 C 00770 NA

01/11/18 01/11/18

.50 HRS

R&R tailings drive belt

CORRECTION: Remove and replace tailings drive belt, Check operation of

tensioner pivot

87315599

BELT

91.83

91.83

PARTS LABOR 91.83 64.32

CONTINUED ON PAGE 15

hereby acknowledge my indebtedness in the amount of \$\_ amount owing or balance owing as shown hereon

(signature)

(signature)

(date)

Sware Ventures Ship to: 9 DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5

E	IN\	0	ICE
treet			

CAMROS 4149 39 S Camrose, AB T4V 3X8 (780) 672-9136 (780) 672-4582

Toll Free: 1-855-763-1427

Fax

Branch			
CAMROSE Date	Time	- control	Page
02/12/18 Account No.	13:38:4 Phone No.	4 (0)	15 Reference No.
SWARE005	7806623	080 hase Order	W12291
Ship Via	Fuic	mase Order	
	G.S.	T. No.	

#### nvoice 825 724 032 RT0001 Salesperson Credit Card No. 682 **Description of Work and Parts** HRS WARRANTY DATE Fold -HRS PIN/EIN STK#/FLEET# 117859 2644 HAJ110196 Combine CR9070 1672 156.15 SEGMENT TOTAL ==> 13300028 SEGMENT#25 C 00770 NA 01/11/18 01/11/18 4.00 HRS Oil leak at LH steering cylinder Remove hydraulic lines, Remove LH steering cylinder from combine. wash cylinder so it is clean before dis-assembly, remove end cap from cylinder, clean bore of the barrel out check for scoring, no scoring found, Remove piston from the rod, slide end cap off rod and found that rod has some deep pitting. Customer took rod to get re-chromed. Install seals that customer got for cylinder. Assemble end cap back onto rod, install piston onto rod, install assembly into barrel and tighten end cap, re- install cylinder onto combine. Attach hydraulic lines, start unit and check for leaks, no leaks found 17.00 17.00 FREIGHT 1 FREIGHT' 17.00 PARTS 557.44 LABOR 574.44 SEGMENT TOTAL ==> 13300028 01/11/18 01/11/18 SEGMENT#26 C 00770 NA .50 HRS Repair LH tail light CORRECTION: Remove and replace LH header hazard light bulb that was burnt out ADDITIONAL DESCRIPTION: - bulb burnt out 5 15 5.15 1 BULB 84129422

(date)

hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate love machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms statactory with you and until paid in full, an express mechanic's lien is acknowledged on above machine to secure the amount repairs thereto. It is understood that the company assumes no responsibility for loss or damage by first or fire to machine aced with them for storage, sale, repair or white being tested. Estimates are for labour only, materials additional.	1 24

86616247

(signature)

BULB

eretry	<b>pokeno</b> n	whedge i	enny let	ncie (14	edi	***	in 1	fine.	amount	्रा	<b>\$</b>	being	the	totai	
wount	awing a	or balan	COB CIV	Minnig:	Brit. 1	PUCH	ym f	HEF	BOSPA.						

(signature)

8.15

CONTINUED ON PAGE 16

8.15

Sware Ventures

Of oils

Don Sware

52429 RGE RD 183

BEAVER COUNTY AB TOB 4J5

E INVOICE

CAMROSE 4149 39 Street Camrose, AB T4V 3X8 Tel: (780) 672-9136

Fax: (780) 672-4582 Toll Free: 1-855-763-1427

Branch				
CAMROSE Date	Time		namico (memico)	Page
			101	rage
02/12/18 Account No.	Phone No	8:44	(O)	Reference No.
SWARE005	7806	62308	0	W12291
Ship Via		Purchas		May the Committee and Committe
				A CONTRACTOR OF THE CONTRACTOR
		G.S.T. N		
		825	724 03	32 RT0001
Credit Card No.			Sale	sperson
			1 6	82

#### **Description of Work and Parts** STK#/FLEET# WARRANTY DATE HRS HRS PIN/EIN Fold -117859 Combine 2644 HAJ110196 CR9070 1672 13.30 PARTS 33.50 LABOR 46.80 13300028 SEGMENT TOTAL ==> SEGMENT#27 C 00770 NA 01/11/18 01/11/18 Flush unloading auger gearbox 3.00 HRS CORRECTION: Drain gearbox out of gearbox found it to be really milking looking, flushed gearbox with diesel 3 times running it a little each time, till it stayed clean, drain diesel out and fill with new gear oil 26.75 26.75 B80902 80W90 1GAL 7 .40 OIL1 ENVIRO OIL LTR .10 27.15 PARTS 432.82 LABOR 459.97 13300028 SEGMENT TOTAL ==> SEGMENT#28 C 00770 NA 01/11/18 1.00 HRS Blow out radiator 01/11/18 01/11/18 SEGMENT#29 C 00770 NA 4.00 HRS Fuel leaking at engine controller CORRECTION: use air to blow off debris and build up around engine controller. Remove harness's from engine controller, Remove mount bolts for engine controller. Put catch pans below engine to catch diesel fuel that drains out of cooler. Remove engine controller, found o-ring that seals engine controller to fuel cooler plate to be in poor shape. Ordered new o-ring. Remove o-ring and clean up surfaces CONTINUED ON PAGE 17

(date)

I hereby authorize the above work to be done along with the use or necessary meanteness. For any over insorpers may be above machine for purposes of testing, inspection of delivery at my risk. I agree to pay cash on delivery of machine or on terms setisfactory with you and until paid in full, an express mechanic's lien is advinceded on above machine to secure the amount of repairs thereto. It is understood that the company assumes no responsibility for loss or done for the to machine placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional.	) here amou

(signature)

hereby	r ackno	wheetge	my	insteb	herák	ness in	the	arresent	Of.	<b>\$</b>	pound	200	total	
amount	owing	or bala	nce	owing	89	shown	hes	AICH)						

(signature)

(date)

Sware Ventures Ship to: ţ DON SWARE 52429 RGE RD 183 BEAVER COUNTY AB TOB 4J5 INVOICE

CAMROSE 4149 39 Street Camrose, AB T4V 3X8

(780) 672-9136 (780) 672-4582 Fax Toll Free: 1-855-763-1427

Branch			
CAMROSE Date	Time	MANAGO CO LO CONTROLO DE PROPERTO DE LA MANAGO COMPANSA DE CONTROLO DE CONTROL	Page
02/12/18		3:44 (0)	17 Reference No.
Account No.	Phone No.		
SWARE005		523080 Purchase Orde	W12291
Ship Via		ruichase Olde	ı
A CONTRACTOR OF THE PROPERTY O		3.S.T. No.	4) 4.4
	Hamiladoreasion	825 724 0	32 RT0001
Credit Card No.	WATER THE PARTY OF	Sale	esperson
			682

#### HRS WARRANTY DATE HRS PIN/EIN STK#/FLEET# 2644 HAJ110196 Combine 1672 CR9070 that o-ring seal on, Check to make sure all fittings are tight. Install new o-ring, install engine controller and

**Description of Work and Parts** 

secure with hardware. Attach wiring harness's to controller. Bleed air from fuel system. Start unit and run, no leaks found. 2 brake Clean CPM-4

24.00 1 N GASKET 504184521 PARTS LABOR

33.28 525.28

558.56 SEGMENT TOTAL ==> 13300028

01/11/18 01/11/18 SEGMENT#30 C 00770 NA

Service cab air filters (2)

1.00 HRS

4.64

CORRECTION:

117859

Remove and replace both cab filters, Clean housing by ladder platform out was packed right full of dirt.

ADDITIONAL DESCRIPTION:

- clean out filter housing

AF25557 AF27866

FILTER, AIR FILTER, AI

61.70 1 0 47.59 1 PARTS

47.59 109.29

61.70

Fold -

9.28

24.00

LABOR

128.64

SEGMENT TOTAL ==>

237.93

SEGMENT#31 C 00770 NA

01/11/18 02/06/18

3.00 HRS

Set concave clearance

CORRECTION:

13300028

set concave position, Set RH side a good as possible, LH side is set good. RUn combine to set zero stops, Calibrate concave position. Install concave extensions.

I hereby authorize the above work to be done along with the use of necessary in above machine for purposes of testing, inspection or delivery at my risk. I agree satisfactory with you and until paid in full, an express mechanic's lien is acknow of repairs thereto. It is understood that the company assumes no responsibility placed with them for storage, sale, repair or while being tested. Estimates are for	edged on above machine to secure	the amount machine amount owing or	edge my indebtedness in the amount of \$ balance owing as shown hereon.	being the total
		(#4QP-#RV-F0)		(3818)
(signature)	(company)			

Ship to:

nvoice to:

COV4 / PT PPD4

Ventures	

52429 RGE RD 183

BEAVER COUNTY AB TOB 4J5

DON SWARE

INVOICE CAMROSE 4149 39 Street

Camrose, AB T4V 3X8 (780) 672-9136

(780) 672-4582 Toll Free: 1-855-763-1427

WARRANTY DATE

Branch					
CAMROSE Date	Time	AND THE PARTY OF T			Page
02/12/18	13;	38:44 (	0)		18
Account No.	Phone N	0,		Kete	rence No.
SWARE005	780	5623080		W12	291
Ship Via		Purchase	Order		
A CONTRACTOR OF THE CONTRACTOR		G.S.T. No.			
		825 7	24 03	32 R	T0001
Credit Card No.	- Alexander de la company de l	A	Sale	spers	on
			6	82	

HRS

### **Description of Work and Parts**

117859 Combine 2644 HAJ110196	
CR9070 1672	
LABOR	407.36
13300028 SEGMENT TOTAL==>	407.36

UDC DIN/RIN

SEGMENT#32 C 00770 NA 01/11/18 02/05/18 Check engine fan pulleys

CORRECTION:

Remove engine fan drive belts. Remove tensioner pulley and check condition of bearings they are quiet and roll smooth, roll fan over and check bearings on shaft, same thing they roll smooth and are quiet, install tensioner pulley back on bracket and install belts, tension belts to spring guage

SEGMENT TOTAL ==>

194.30

194.30

Fold --

SEGMENT#33 C 00770 NA

01/11/18 02/09/18

Post repair run-up & calibration

3.00 HRS

LABOR

CORRECTION:

13300028

Run combine up post repair, check and run all functions to make sure they all work correctly. Perform running calibrations, Park in yard for customer pick-up

ADDITIONAL DESCRIPTION:

- install shields

SEGMENT TOTAL ==>

392.62 392.62

SEGMENT#34 C 00770 NA

01/11/18 01/29/18

Replace wear plate at top of feeder.

CORRECTION:

13300028

Remove and replace wear plate/ feeder transition at top of feeder, Clean paint out of threads on new plate. Install 5

CONTINUED ON PAGE 19

LABOR

		I hereby acknowledge my indebtedness in the amount of \$being the total amount owing or balance owing as shown hereon.
		(signature) (date)
-	(signature)	

A. C.	Rocky Mountain Equipment Canada Ltd. O/ a Rocky mousteast Equipment
	Sware Ventures
3	
dius	
<b>L</b>	
9	DON SWARE
စ	52429 RGE RD 183
voice to:	BEAVER COUNTY AB TOB 4J5
2	

CAMRO	SE
4149 39	Street
Camrose	, AB T4V 3X8
Tel	(780) 672-9136

(780) 672-4582 Toll Free: 1-855-763-1427

Branch				
CAMROSE Date	Time			Page
02/12/18	13:3	8:44	(0)	<u>h9</u>
Account No.	Phone No	),		Reference No.
SWARE005	7806	62308	30	W12291
Ship Via	William State of the State of t	Purcha	se Order	Ť
		G.S.T.	No.	
		825	724 0	32 RT0001
Credit Card No.	71	Barrier Control of the Control of th	Sale	sperson
			Elisa de la composição de	682

## **Description of Work and Parts**

S. MANANIAN CO. C.		4444000 3000 4 (2000 100 100 100 100 100 100 100 100 100				
STK#/FLEET	**	HRS PIN/EIN	WARRA	NTY DATE	HRS	Fold
L17859	Combine	2644 HAJ11019	5			
	CR9070	1672				
new count	er sunk screw in	feeder floor that reta	ain the new			
		er mounting hardware.				
		etween the floor and				
plate.						
84814920		SCREW	5 N	4.75		23.75
86603002		ANGLE	1 N	453.60		453.60
				PARTS		477.35
				LABOR		337.68
13300028			SEGMENT	TOTAL==>		815.03
20000000						***************************************
SEGMENT#3	5 C 00770 NA	01/11/18 01/31/1	8			
	wear strips under					
CORRECTIO						
		wear strips in feeder	house.			
	new strip x 3 with					
14442134		SCREW	12	1.44		17.28
86551643		WEAR STRIP	3	42.55		127.65
00331043				PARTS		144.93
				LABOR		205.02
13300028			SEGMENT	TOTAL==>		349.95
13300020						
	The state of the s		NECTOR PROPERTY AND ADDRESS OF THE PROPERTY OF	The second secon		

SEGMENT#36 C 00770 NA

01/11/18 02/05/18

Install new rotors.

#### CORRECTION:

Bring both rotor Crates up to shop. Dis-assemble both crates and remove straps from rotors. Use fork lift to move rotors into shop, sweep snow off rotors and let them unthaw. Install installation tool stub shaft onto rotor, Install Both rotors into combine and secure in position with come alongs. Clean all old silicone off front bearing

	I hereby authorize the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of mechine or on terms satisfactory with you and until paid in full, an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional.		
(signature) (date)	(signature) (date)	(signature) (date)	



DON SWARE 52429 RGE RD 183
52429 RGE RD 183
52429 RGE RD 183
52429 RGE RD 183
BEAVER COUNTY AB TOB 4J5

CAMROSE 4149 39 Street Camrose, AB T4V 3X8

Tel: (780) 672-9136 Fax: (780) 672-4582 Toll Free: 1-855-763-1427

Branch	CONTRACTOR		***************************************	differential and the colorest trains
CAMROSE	and		ETTERN THIN IN A CAME	4
Date	Time			Page
02/12/18	13:3	8:44 (0)		20
Account No.	Phone No	<b>0</b> .	Refe	rence No.
SWARE005	7806	7806623080		291
Ship Via		Purchase Order		
		G.S.T. No.		
		825 724 0	32 R	T0001
Credit Card No.		Sale	espers	ion
			682	

### **Description of Work and Parts**

STK#/FLEET#

117859

Combine

HRS PIN/EIN

HAJ110196

2644

WARRANTY DATE

HDC

Fold - -

R9070

1672

plate. Remove old front rotor bearings from bearings plate. Remove installation stub shafts and install rotor stub shafts With new bolts that came in rotor and loctite torqued bolts to 45 ft/lbs. Clean up stub shafts. Install bearing plate onto combine, and secure with hardware. install 5 shims on each rotor, release come a longs and slide rotors forward. check clearances at the front of rotor and bearing plate. Clearance is 3 mm and max allowed is 5 mm. Leave rotors with 5 shims on each of them. Install new lock collars, re-install rotor speed sensor. clean silicone off covers above bearing plate, install covers and silicone all gaps. Remove silicone from bands and covers at rear of rotors. Install cover and secure hardware, silicone all seams on rear covers. Remove bolts from rotor drive coupler between rotor gearbox's to time rotors, Move rotors so they are sitting in proper position and are now timed. Install bolts back into coupler and secure in position. Silicone seams on both sides of rotor cage at the front on the inside. Roll rotors by hand to verify clearances at the front of the rotors they are good.

LIGHT OF THE LOCOLS CHEA	are good.			
120044	BOLT, CARRIAGE	1	2.52	2.52
140046	LOCKWASHER	4	1.10	4.40
337475	HEX NUT	1	.46	.46
39916	URETHANE SEALNT	1	16.25	16.25
47851534	COLLAR	2	15.31	30.62
84482626	HOUSING, B	2	195.48	390.96
86629541	BOLT	1	1.44	1.44
9706685	NUT	2	. 65	1.30
9706687	SCREW, CAP	1	2.25	2.25
3700007			PARTS	450.20
		CONT	TRITIED ON PAGE 21	

I hereby authorize the above work to be done along with the use of necessary materials. You and your above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery satisfactory with you and until paid in full, an express mechanic's lien is acknowledged on above machin of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by the placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials.	et to secure the amount eft or fire to machine		being the total
		(signature)	(date)
(signature)	(date)		



Sware Ventures

Invoice to:

DON SWARE 52429 RGE RD 183

BEAVER COUNTY AB TOB 4J5

CAMROSE 41 49 39 Street Camrose, AB T4V 3X8

Tel: (780) 672-9136 Fax: (780) 672-4582 Toll Free: 1-855-763-1427

Branch		
CAMROSE Date	Time	Page
02/12/18	13:38:44	(0) 21
Account No.	Phone No.	Reference No.
SWARE005	7806623080	0 W12291
Ship Via	Purchase	e Order
and the state of t	G.S.T. N	
	825	724 032 RT0001
Credit Card No.	WALL COMPANY OF THE PARTY OF TH	Salesperson

INVOICE

### **Description of Work and Parts**

HRS WARRANTY DATE STK#/FLEET# HRS PIN/EIN 2644 HAJ110196 117859 Combine CR9070 1672 1287.74 LABOR 1737.94 SEGMENT TOTAL ==> 13300028

(date)

\*\*\*\*\* WORK ORDER TOTALS \*\*\*\*\* 31011.07 PARTS 15285.60 LABOR 100.00 DISPOSAL FEE 350.00 SHOP SUPPLIES 4629.11 DISCOUNT 42117.56 SUB TOTAL ==> 2106.01 GST 825724032 44223.57 TOTAL CASH/DEBIT/CHK

000728

(signature)

I hereby authorize the above work to be done along with the use of necessary materials. You are exposed in the property of machine or on terms above machine for purposes of testing, inspection or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full, an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that the company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while being tested. Estimates are for labour only, materials additional.

hereby acknowledge my indebtedn smount owing or balance owing as s		being the total
	MATERIA SANT SANT SANT SANT SANT SANT SANT SAN	(date)